

Inspector: Flightlog: 11078

Date: 23.10.2024

Landings: 10445

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
24	Alternator	Overhaul	ALX-9525B	18.05.2022	144	115	18.05.2034
				10893	1800	1622	12700
			# H-W010841	10114		0	
24	Alternator Brushes	Inspection and replacement (if required)		18.05.2022		0	
				10893	500	322	11400
				10114		0	
24	Alternator Drive	Inspection / Replacement refer TCM SB 95-3	Coupling 635796	18.05.2022		0	
				10893	500	322	11400
			78254	10114		0	
25	ELT Battery	Replace - due 05/2027	S18 20 516-99	17.11.2020	72	31	01.05.2027
			TM0000190769	10797		0	
				10023		0	
25	Safety Belts Crew / Passengers	N/A by LTA91 deleted	ref.Form One 14024/04	29.04.2004		45	
				7609		0	
						0	
26	Fire Extinguisher	OH	H1-10AIR	18.10.2017	120	36	18.10.2027
			0074-00			0	
			16475			0	
28	Flexible Fuel Hoses in Wing	Replacement refer LTA 46	AE 303 - 4	27.09.2019	96	35	27.09.2027
			Piper P/N 565-185	10648		0	
						0	
29	Flexible Hydarulik and Brake Hoses installed in Airframe	Replacement refer LTA 46	AE 303-4RL	16.02.2017	96	4	16.02.2025
				10147		0	
						0	
29	Hydraulik Pump Motor Brushes	Inspection / Replacement	HYC 5005 RX	29.11.2019		0	
			ESQ - 12S ( Brush Set )	10697	500	122	11200
			# AH-8903			0	

Inspector:                      Flightlog:            11078

Date: 23.10.2024

Landings:            10445

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
32	Drag and Side Brace Link Bolts - 1000 hr Airframe	Inspect - Replace as required		11.07.2018		0	
				10398	1000	322	11400
						0	
32	Torque Link Bolts and Bushings - 500 hr Airframe	Inspect - Replace as required		18.05.2022		0	
				10893	500	322	11400
				10114		0	
35	Oxygen Bottle 48,3 cu ft	Hydrostatic Test - Due 06/2026	DOT 3AA - 1800	18.06.2021	60	20	18.06.2026
			800112-01	10852		0	
			# 068673	10080		0	
35	Regulator - Oxyge bottle			18.06.2021	60	20	18.06.2026
			800114-04	10852		0	
			# 9210	10080		0	
54	Mount Kit - Engine	Overhaul - N/A	J 9613-58	18.05.2022	144	115	18.05.2034
				10893	1800	1622	12700
				10114		0	
61	Propeller / 500HRS	Sludge removal	PHC-C3YF-1RF	18.05.2022		0	
				10893	500	322	11400
			# EE 1485	10114		0	
61	Propeller Governor	OH ref. Woodward SB 33580 latest Revision - - 72 Mon N/A when flying more than 120 hrs / year	Woodward G210681	18.05.2022		0	
				10893	1800	1622	12700
			1157974 - AA/AC-AD	10114		0	
61	Propeller OVHL	OH refer Hartzell SL-61-61Y latest Revision - OH date 11.01.2022	PHC-C3YF-1RF	18.05.2022	72	43	18.05.2028
				10893	2400	2215	13293
			EE 1485	10114		0	
72	Engine OVHL - refer TCM Manual M-0	Overhaul	TCM TSIO 360-FB(9B)	18.05.2022	144	115	18.05.2034
				10893	1800	1615	12693
			# 834900 - R	10114		0	

Inspector: Flightlog: 11078

Date: 23.10.2024

Landings: 10445

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
73	Fuel carring flexible Hoses / Engine	Replace	303-6	18.05.2022	96	67	18.05.2030
			303-4	10893	1000	822	11900
				10114		0	
73	Fuel Pump - OVHL	Overhaul	TCM 649368-26 A1	18.05.2022	144	115	18.05.2034
				10893	1800	1622	12700
			# B 07AA179R	10114		0	
73	Manifold Valve - OVHL	Overhaul	TCM 641032-11A8	18.05.2022	144	115	18.05.2034
				10893	1800	1622	12700
			# C07AA171R	10114		0	
73	Meeterig Unit - OVHL	Overhaul	TCM 640563-15A9	18.05.2022	144	115	18.05.2034
				10893	1800	1622	12700
			# A07AA145R	10114		0	
74	Magneto LH 500 H Insp	Inspection refer TCM SB 643 latest Revision	TCM S6LSC-25P	18.05.2022		0	
			BL-500556-103	10893	500	322	11400
			# D06KA283R	10114		0	
74	Magneto LH - S-20 MFD 11/2006	OH refer TCM SB 643 latest Revision	TCM S6LSC-25P	18.05.2022	48	19	18.05.2026
			BL-500556-103	10893	1800	1622	12700
			# D06KA283R	10114		0	
74	Magneto RH	Inspection refer TCM SB 643 latest Revision	TCM S6LSC-25P	18.05.2022		0	
			BL-500556-103	10893	500	322	11400
			# D06KA275R	10114		0	
74	Magneto RH - S-20 MFD 11/2006	OH refer TCM SB 643 latest Revision	TCM S6LSC-25P	18.05.2022	48	19	18.05.2026
			BL--500556-103	10893	1800	1622	12700
			# D06KA275R	10114		0	
75	Air Intake Filter	Replace	638 873	18.05.2022		0	
			460-632	10893	500	322	11400
				10114		0	

Inspector: Flightlog: 11078

Date: 23.10.2024

Landings: 10445

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
75	Overboost Valve - OVHL	Overhaul	TCM 641404-1	18.05.2022	144	115	18.05.2034
				10893	1800	1622	12700
			# KA000295	10114		0	
78	Turbocharger - OVHL	Overhaul	CF600573-9000	18.05.2022	144	115	18.05.2034
				10893	1800	1622	12700
			# H-TR0821012	10114		0	
78	Turbocharger inspection	1000 hr - i.a.w. Ch 5 Insp. List	CF600573-9000	18.05.2022		0	
				10893	1000	822	11900
			# H-TR0821012	10114		0	
79	Oil carrying flexible Hoses / Engine	Replacement	646644S6S 30.00	18.05.2022	96	67	18.05.2030
			646644S6S 15.00	10893	1000	822	11900
				10114		0	
79	Oil cooler - OVHL	Overhaul		18.05.2022	144	115	18.05.2034
				10893	1800	1622	12700
			# I06-4776-338	10114		0	
80	Starter - OVHL	Overhaul	ES646238-2	18.05.2022	144	115	18.05.2034
				10893	1800	1622	12700
			# H-V100613	10114		0	
98	Dual Manifold Check Valve	Removed with GI275 Installation	1H5-24	01.02.2024		111	
				10988		0	
				10289		0	
98	Gyro Central Filter	Removed with GI275 Installation	D 9-18-1	01.02.2024		3	
			AA D9-18-1	10988		446	
				10289		0	
98	Vacuum Pump	Removed with GI275 Installation	AA3215CC	01.02.2024		0	
				10988		509	
			# 036D25	10289		0	